

Batch Reactor Control

Copyright (c) 2013 Dogwood Valley Press, LLC

Additional internal memory:

Symbol	Address	
RUN	B3/0	On while batch running
STEP_1 to STEP_6	B20/1 to B20/6	Step-in-progress bits
FAST_AGIT_TMR	T4:1	Times fast agitation step
DECR_AGIT_TMR	T4:2	Times decreasing agitation step
COUNT_A	C5:1	Measures amount of A being added
COUNT_B	C5:2	Measures amount of B being added
COUNT_OUT	C5:3	Measures amount of product being drained


Conversion formulas


$$\text{AGIT_AO} = ((\text{AGIT_RPM} / 1000) * (24966)) + 6242$$


$$\text{AGIT_CURR} = ((\text{ACUR_MEAS} - 3277) / 13107) * (20)$$


In Step_5, AGIT_RPM = 500 - DECR_AGIT_TMR.ACC/10


Start/Stop/Pause. Initial start

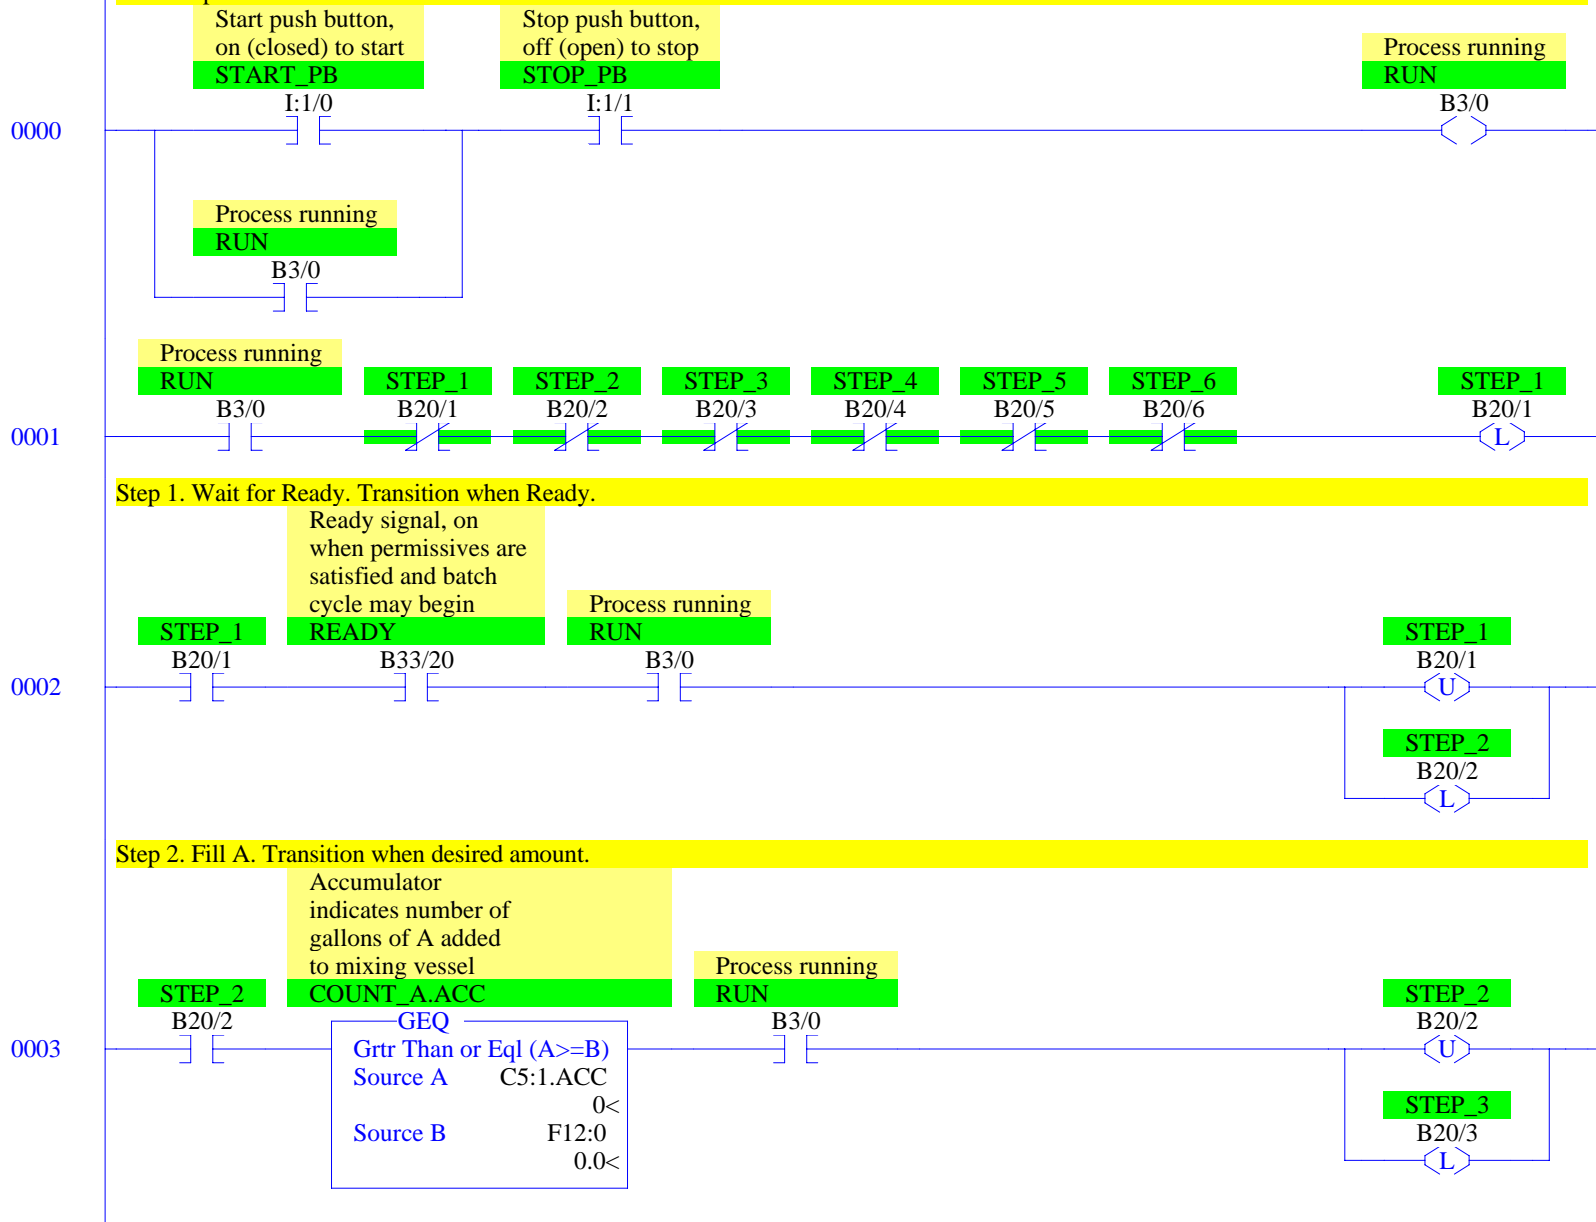


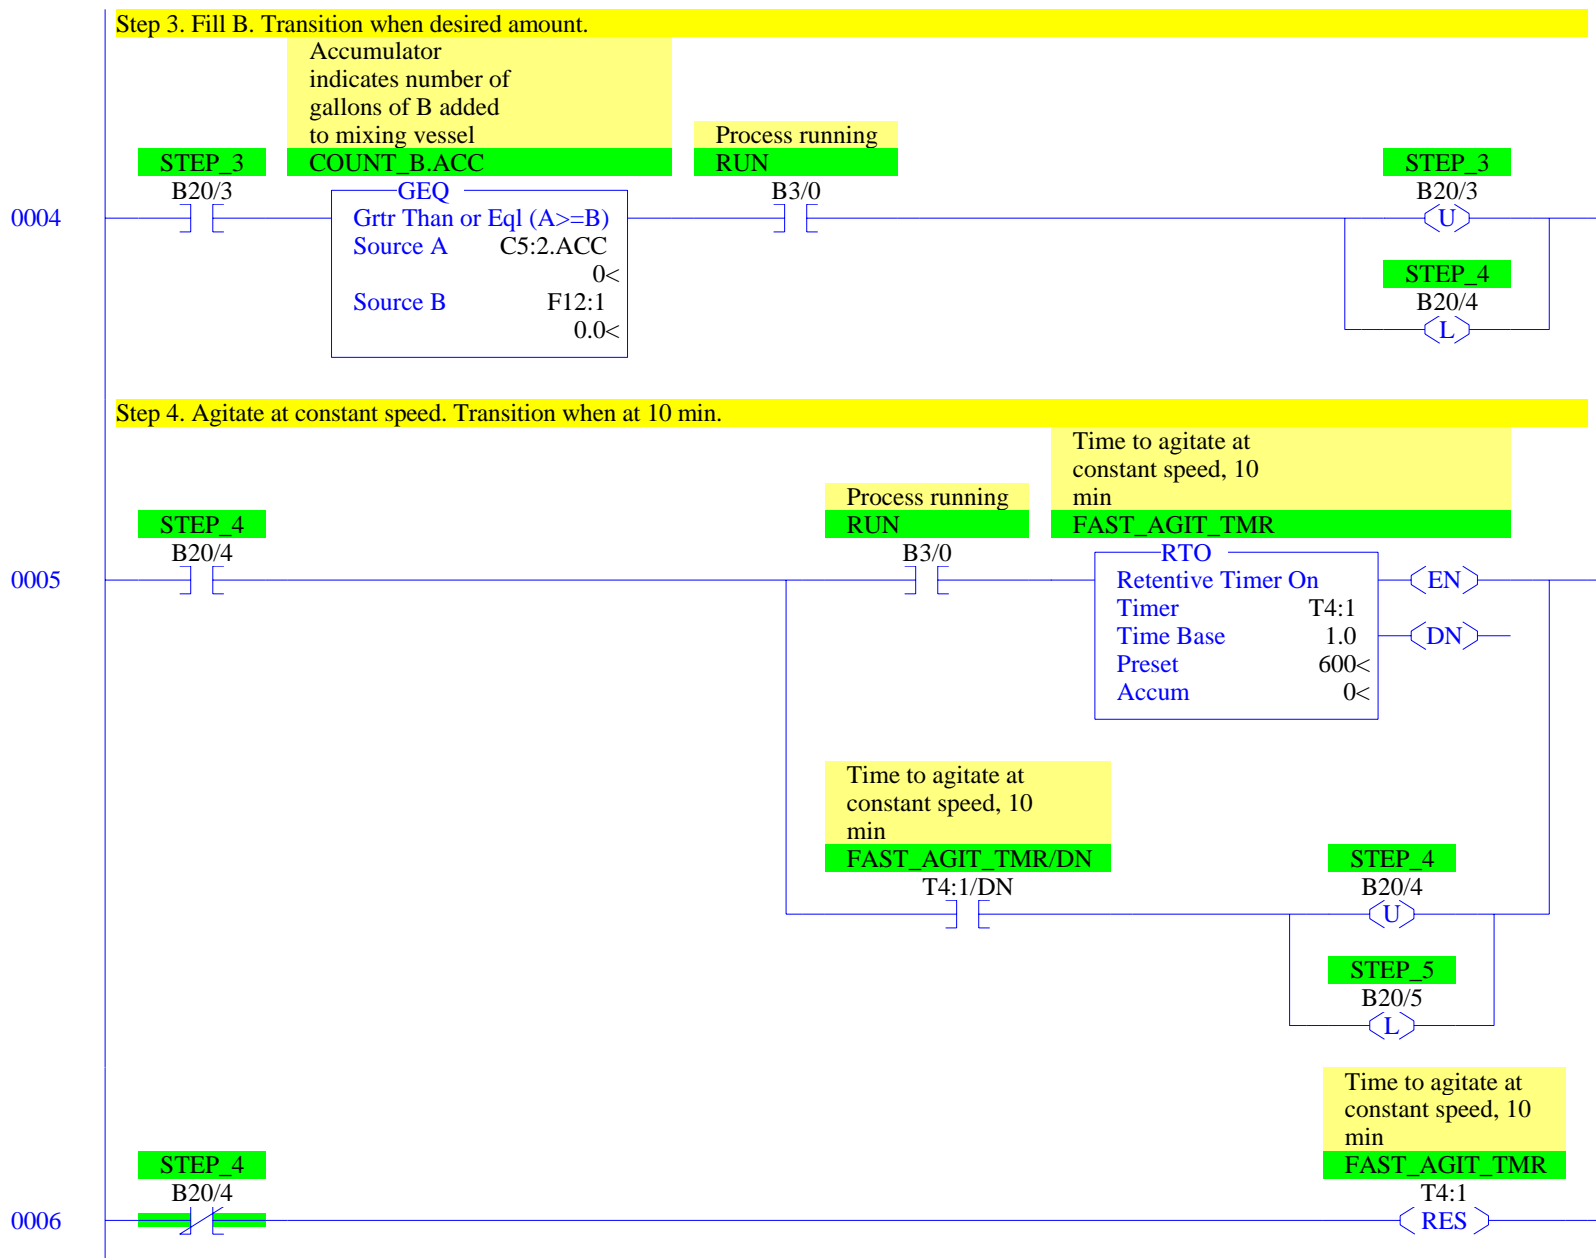


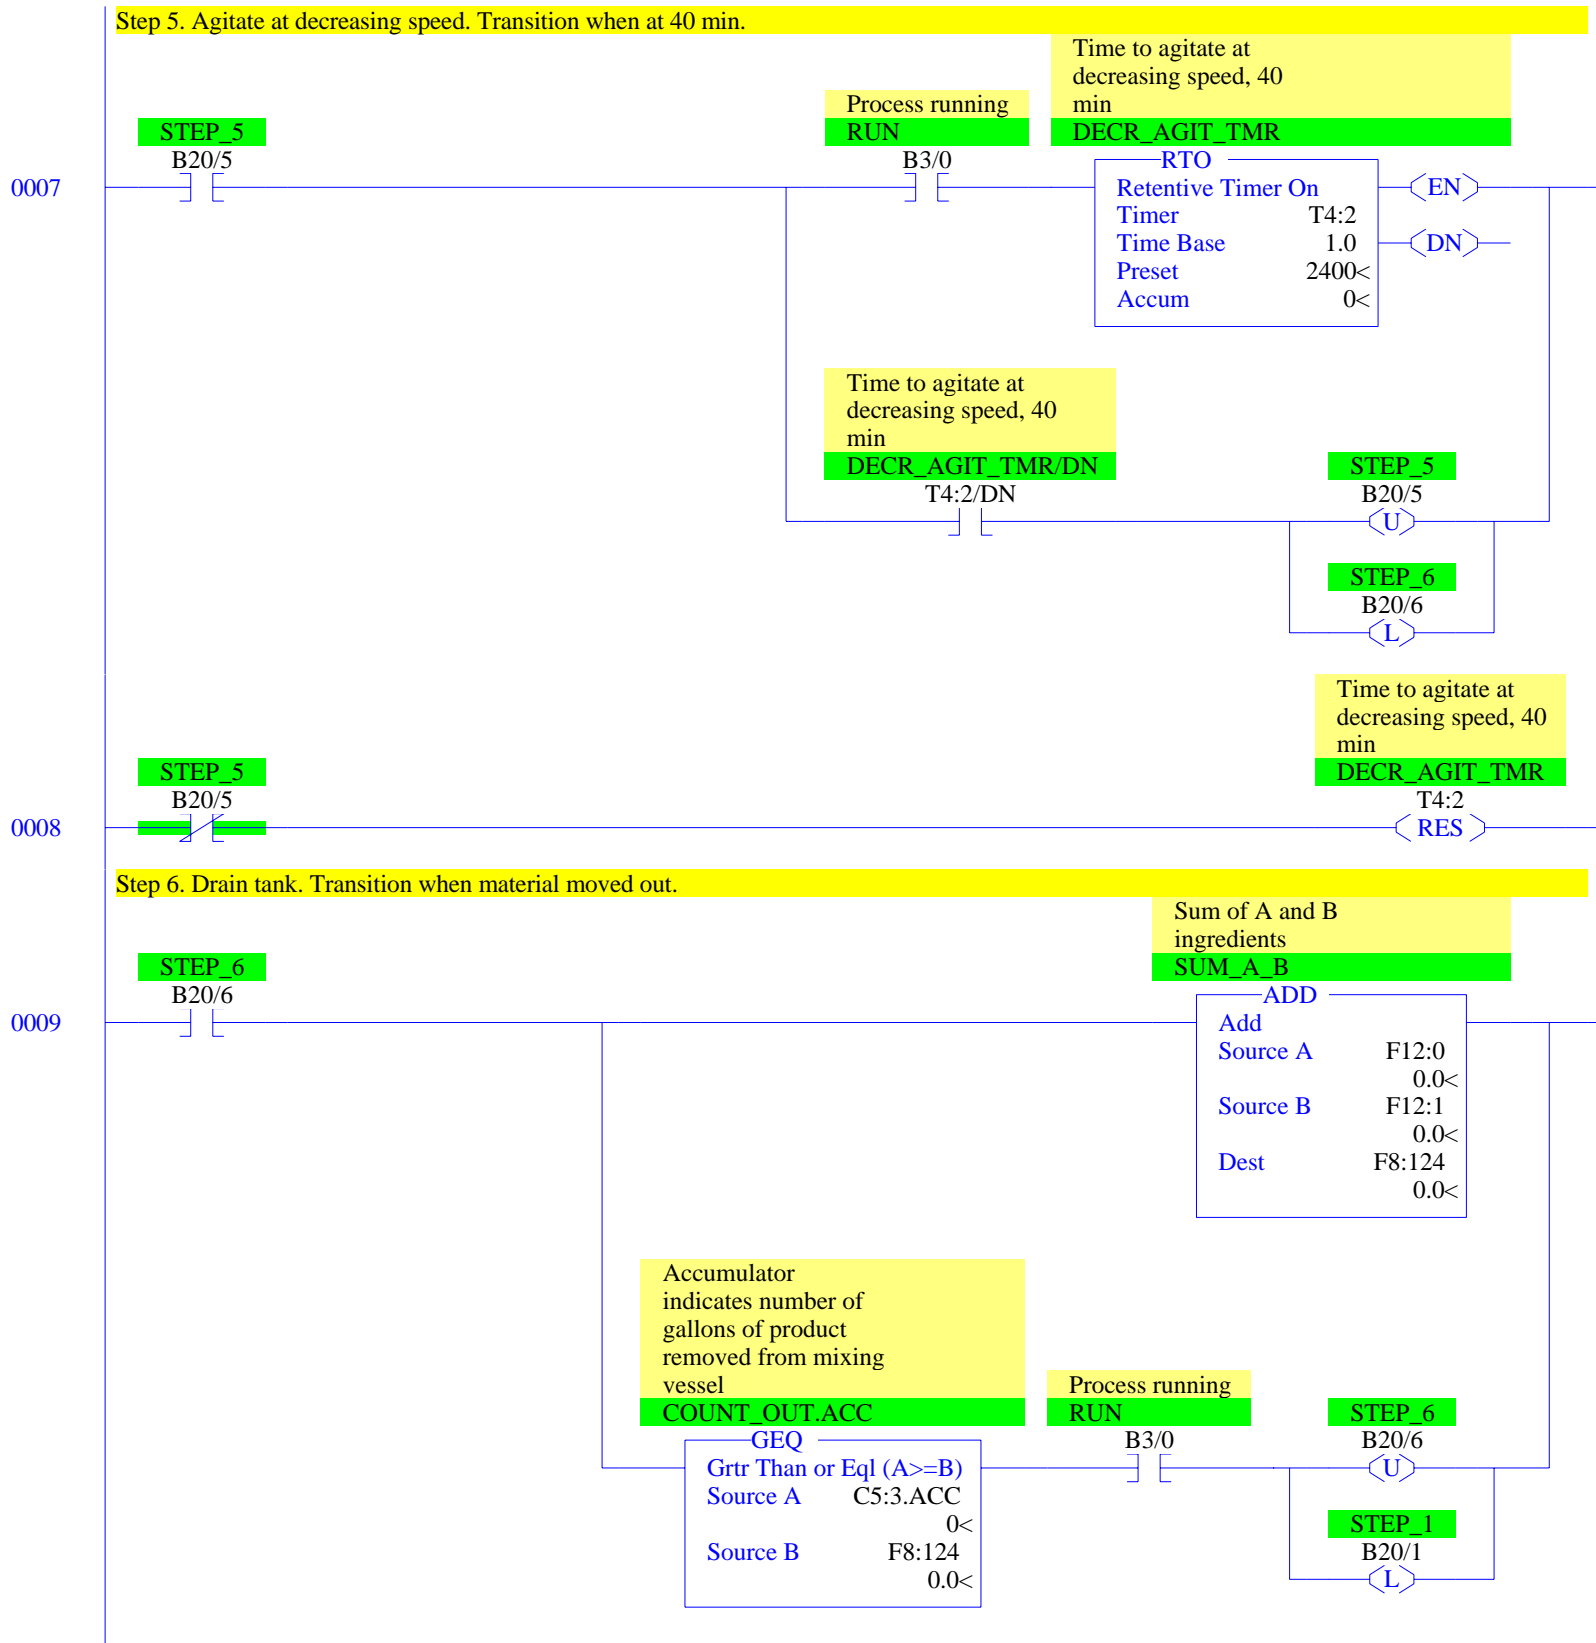

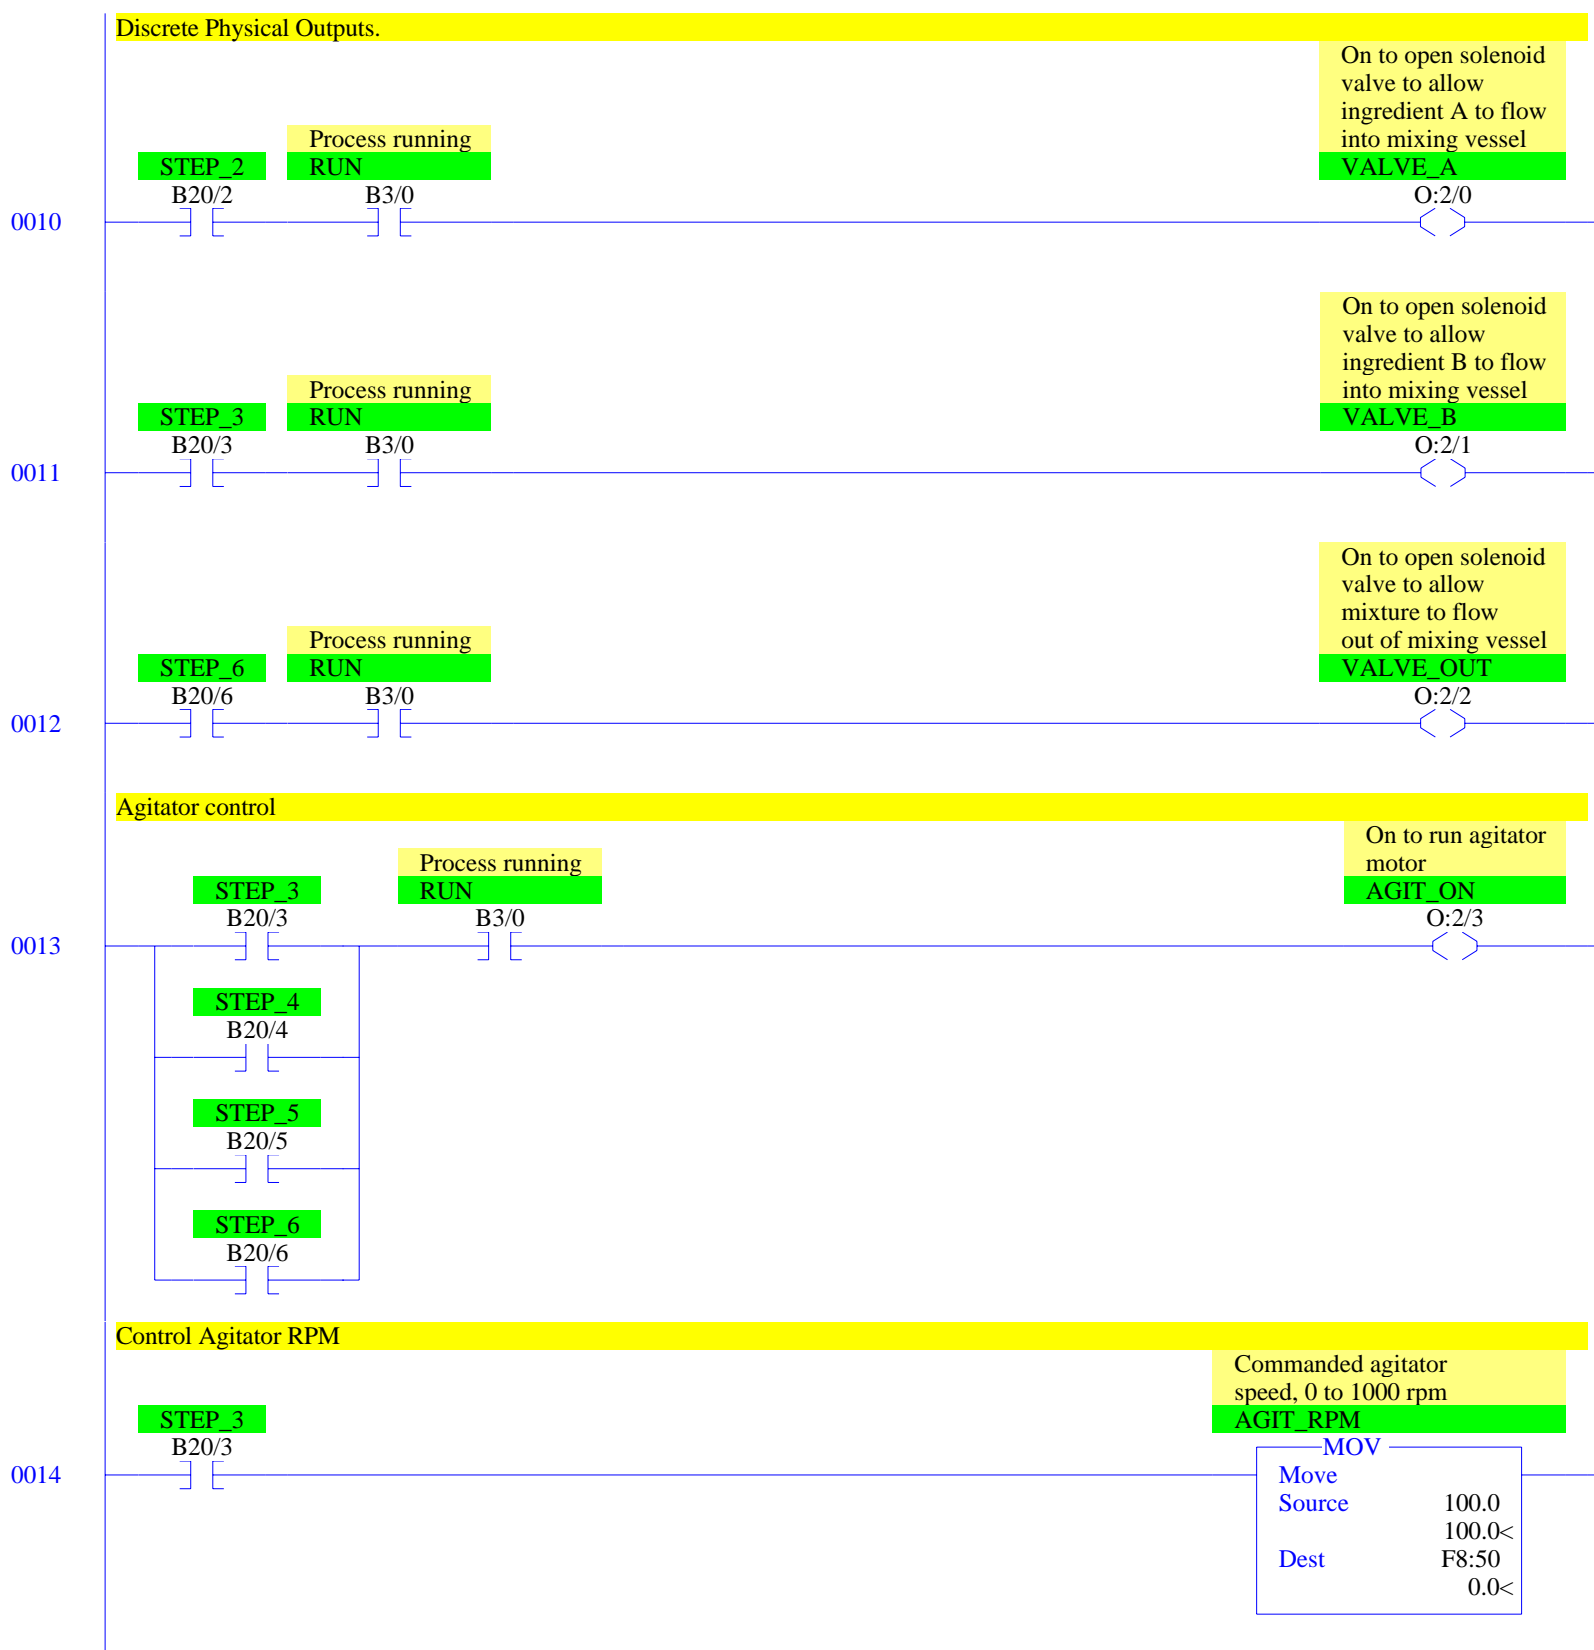

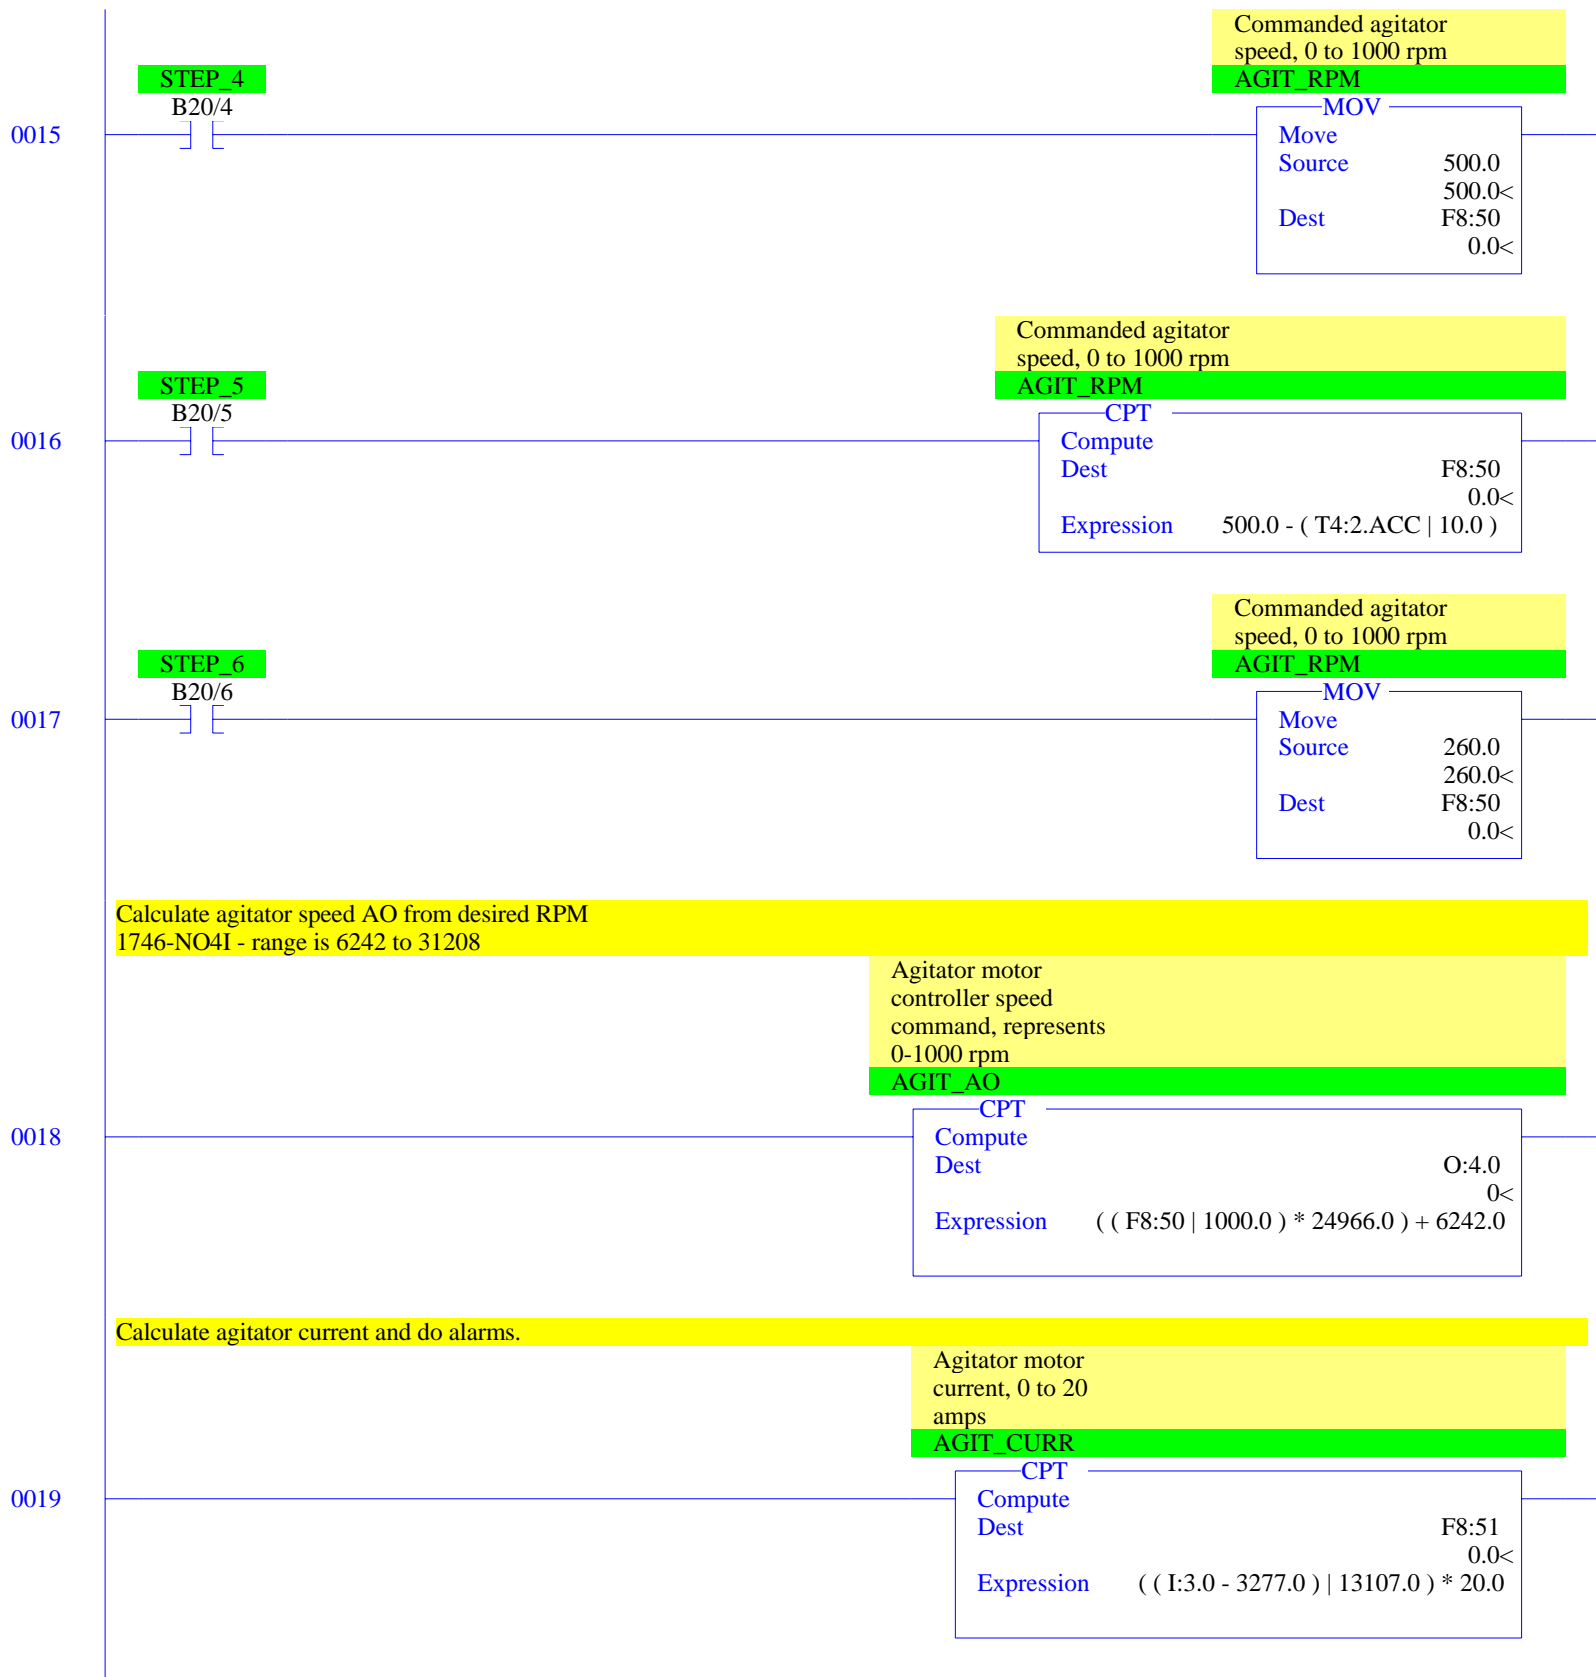

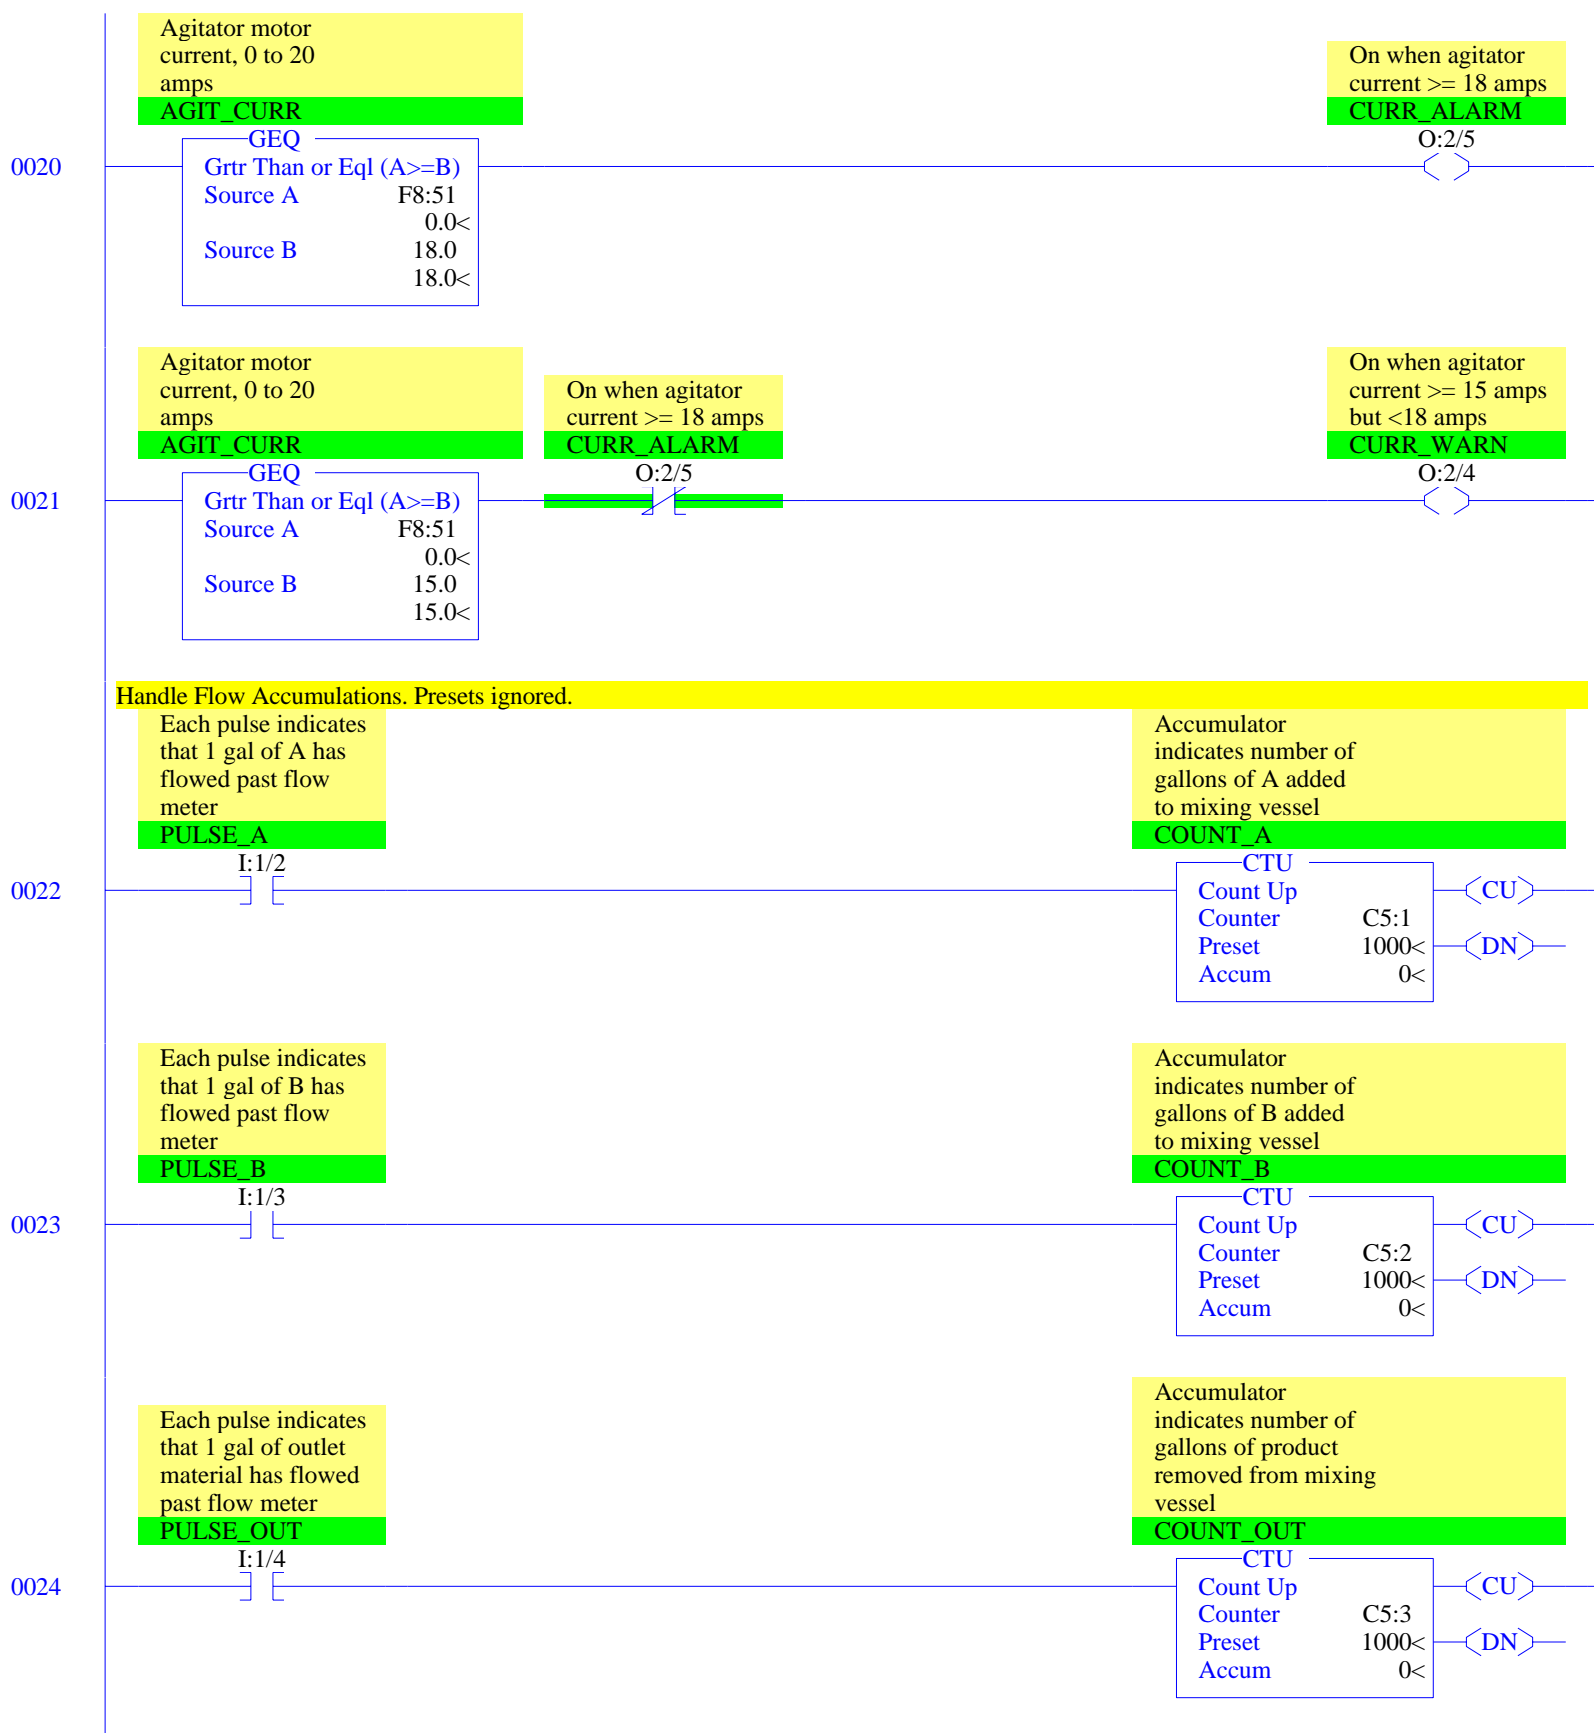

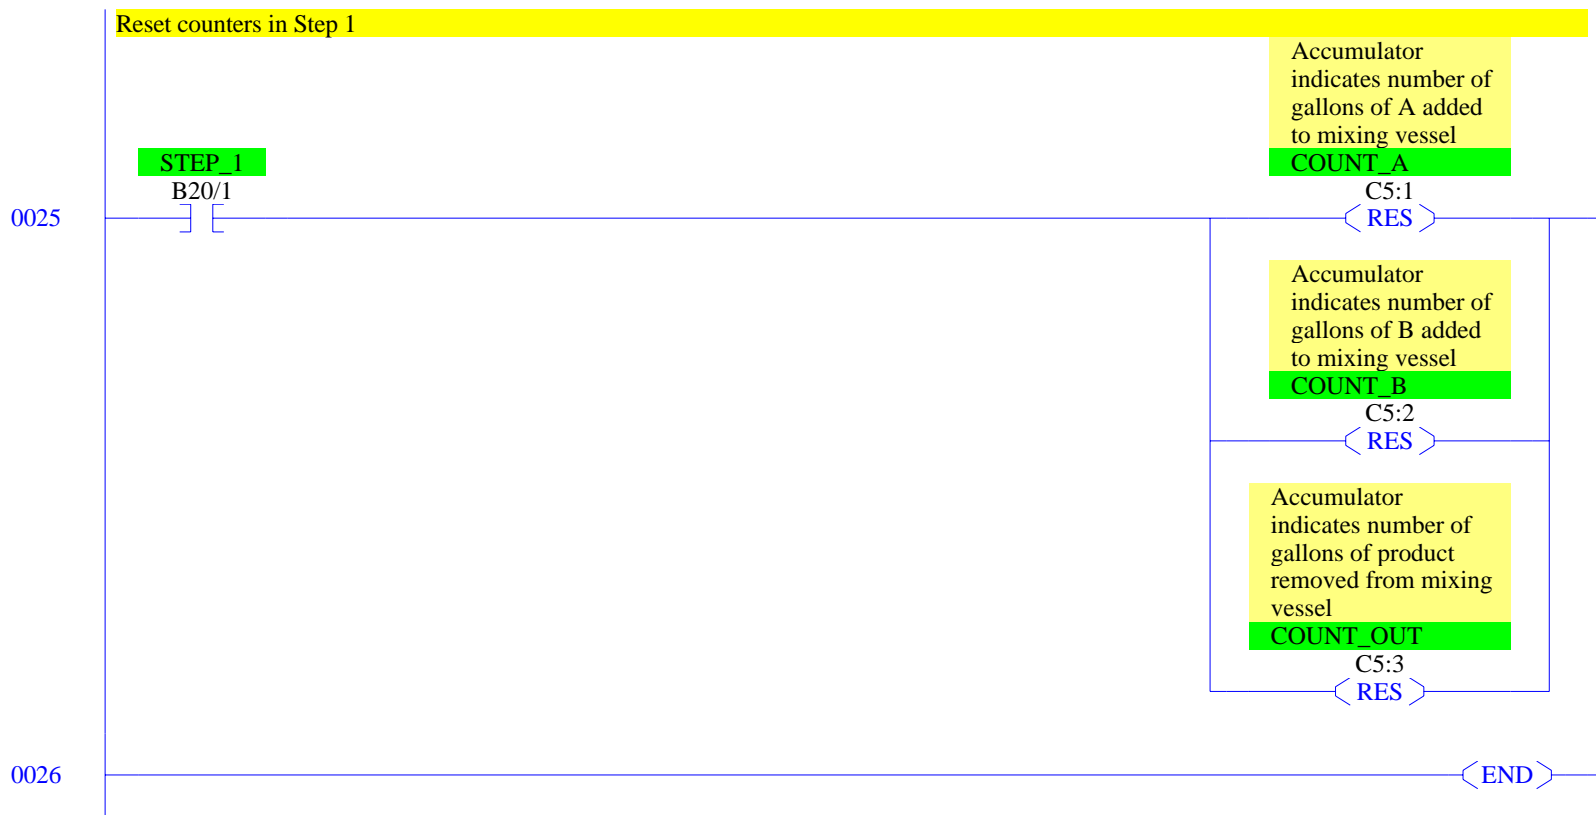

RSLogix 500 Cross Reference Report - Sorted by Address

O:2/0	- {VALVE_A} On to open solenoid valve to allow ingredient A to flow into mixing vessel OTE - File #2 - 10
O:2/1	- {VALVE_B} On to open solenoid valve to allow ingredient B to flow into mixing vessel OTE - File #2 - 11
O:2/2	- {VALVE_OUT} On to open solenoid valve to allow mixture to flow out of mixing vessel OTE - File #2 - 12
O:2/3	- {AGIT_ON} On to run agitator motor OTE - File #2 - 13
O:2/4	- {CURR_WARN} On when agitator current >= 15 amps but <18 amps OTE - File #2 - 21
O:2/5	- {CURR_ALARM} On when agitator current >= 18 amps OTE - File #2 - 20 XIO - File #2 - 21
O:4.0	- {AGIT_AO} Agitator motor controller speed command, represents 0-1000 rpm CPT - File #2 - 18
I:1/0	- {START_PB} Start push button, on (closed) to start XIC - File #2 - 0
I:1/1	- {STOP_PB} Stop push button, off (open) to stop XIC - File #2 - 0
I:1/2	- {PULSE_A} Each pulse indicates that 1 gal of A has flowed past flow meter XIC - File #2 - 22
I:1/3	- {PULSE_B} Each pulse indicates that 1 gal of B has flowed past flow meter XIC - File #2 - 23
I:1/4	- {PULSE_OUT} Each pulse indicates that 1 gal of outlet material has flowed past flow meter XIC - File #2 - 24
I:3.0	- {ACUR_MEAS} Raw agitator current measurement, represents 0-20 amps CPT - File #2 - 19
B3/0	- {RUN} Process running OTE - File #2 - 0 XIC - File #2 - 0, 1, 2, 3, 4, 5, 7, 9, 10, 11, 12, 13
T4:1	- {FAST_AGIT_TMR} Time to agitate at constant speed, 10 min RTO - File #2 - 5 RES - File #2 - 6
T4:1/DN	- XIC - File #2 - 5
T4:2	- {DECR_AGIT_TMR} Time to agitate at decreasing speed, 40 min RTO - File #2 - 7 RES - File #2 - 8
T4:2/DN	- XIC - File #2 - 7
T4:2.ACC	- CPT - File #2 - 16
C5:1	- {COUNT_A} Accumulator indicates number of gallons of A added to mixing vessel CTU - File #2 - 22 RES - File #2 - 25
C5:1.ACC	- GEQ - File #2 - 3
C5:2	- {COUNT_B} Accumulator indicates number of gallons of B added to mixing vessel CTU - File #2 - 23 RES - File #2 - 25
C5:2.ACC	- GEQ - File #2 - 4
C5:3	- {COUNT_OUT} Accumulator indicates number of gallons of product removed from mixing vessel CTU - File #2 - 24 RES - File #2 - 25
C5:3.ACC	- GEQ - File #2 - 9
F8:50	- {AGIT_RPM} Commanded agitator speed, 0 to 1000 rpm MOV - File #2 - 14, 15, 17 CPT - File #2 - 16, 18
F8:51	- {AGIT_CURR} Agitator motor current, 0 to 20 amps CPT - File #2 - 19 GEQ - File #2 - 20, 21
F8:124	- {SUM_A_B} Sum of A and B ingredients ADD - File #2 - 9 GEQ - File #2 - 9
F12:0	- {DES_A} Desired amount of A to add, in gal ADD - File #2 - 9 GEQ - File #2 - 3
F12:1	- {DES_B} Desired amount of B to add, in gal ADD - File #2 - 9 GEQ - File #2 - 4

RSLogix 500 Cross Reference Report - Sorted by Address

B20/1	- {STEP_1}
	OTL - File #2 - 1, 9
	OTU - File #2 - 2
	XIC - File #2 - 2, 25
	XIO - File #2 - 1
B20/2	- {STEP_2}
	OTL - File #2 - 2
	OTU - File #2 - 3
	XIC - File #2 - 3, 10
	XIO - File #2 - 1
B20/3	- {STEP_3}
	OTL - File #2 - 3
	OTU - File #2 - 4
	XIC - File #2 - 4, 11, 13, 14
	XIO - File #2 - 1
B20/4	- {STEP_4}
	OTL - File #2 - 4
	OTU - File #2 - 5
	XIC - File #2 - 5, 13, 15
	XIO - File #2 - 1, 6
B20/5	- {STEP_5}
	OTL - File #2 - 5
	OTU - File #2 - 7
	XIC - File #2 - 7, 13, 16
	XIO - File #2 - 1, 8
B20/6	- {STEP_6}
	OTL - File #2 - 7
	OTU - File #2 - 9
	XIC - File #2 - 9, 12, 13, 17
	XIO - File #2 - 1
B33/20	- {READY} Ready signal, on when permissives are satisfied and batch cycle may begin
	XIC - File #2 - 2